
Page 1 of 2 **Document ID: 2152457**

> 2008 Saturn Astra | Astra (VIN A) Service Manual | Driver Information and Entertainment | Cellular, Entertainment, and Navigation | Repair Instructions | Document ID: 2152457

Communication Interface Module Replacement (Left Side)



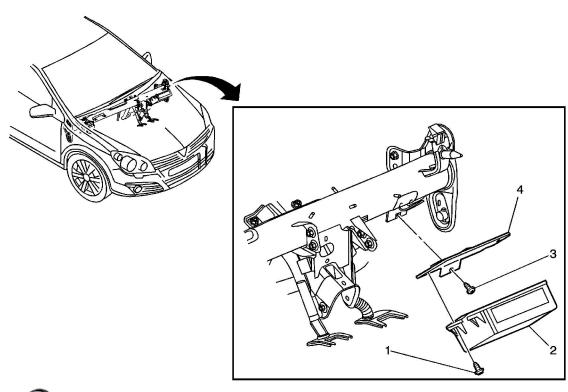

Callout	Component Name	
Preliminary Procedure		
Pemove	the driver knee bolster. Refer to Driver Knee Bolster Replacement.	
IKemove		
	Communication Interface Module Bolt (Qty: 1)	
1 1	Notice: Refer to <u>Fastener Notice</u> in the Preface section.	
	Tighten	
	4 N·m (35 lb in)	
	Communication Interface Module	
	Procedure	
2		
	1. Disconnect the electrical connections.	
	2. Refer to Control Module References for programming and set up procedures.	
	Communication Interface Module Bolt (Otyation). All rights reserved.	

Document ID: 2152457 Page 2 of 2

	Notice: Refer to Fastener Notice in the Preface section.	
3	Tighten	
	4 N·m (35 lb in)	l
4	Mobile Telephone Transceiver	