


Communication Interface Module Replacement

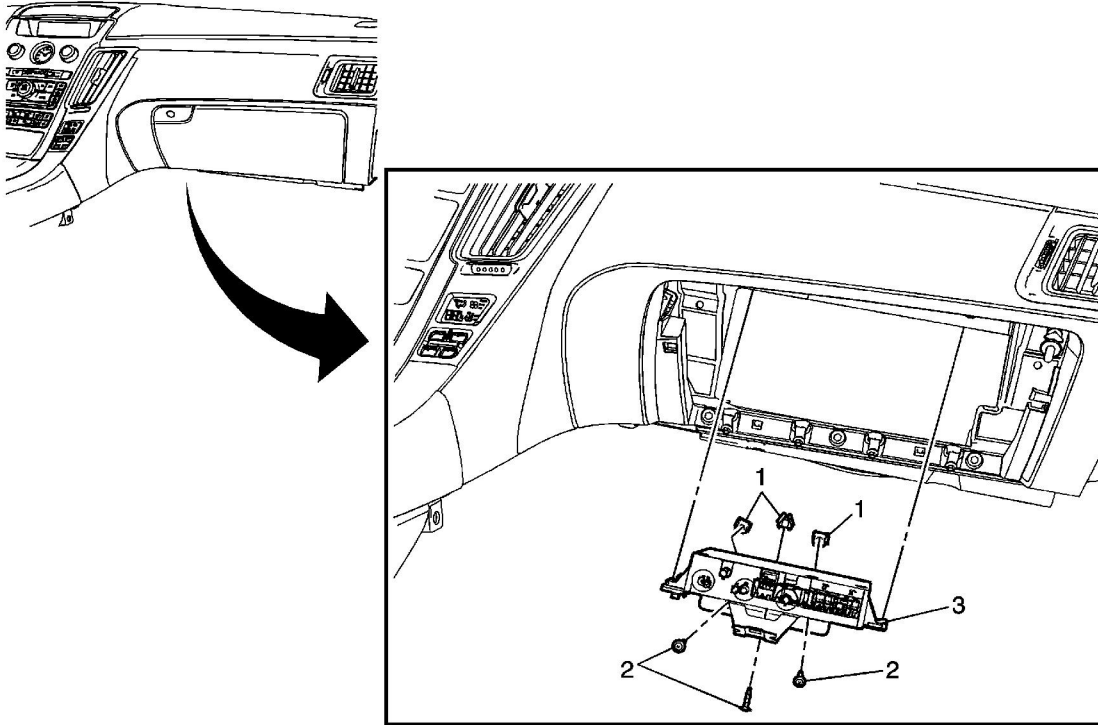

Callout	Component Name
Preliminary Procedure	
Remove the instrument panel compartment. Refer to Instrument Panel Compartment Replacement .	
1	Communication Interface Module Nut (Qty: 3) Caution: Refer to Fastener Caution in the Preface section. Tighten 9 N·m (79 lb in)
2	Communication Interface Module Bolt Screw (Qty: 3) Caution: Refer to Fastener Caution in the Preface section. Tighten 2.5 N·m (22 lb in)
	Communication Interface Module Procedure

© 2011 General Motors Corporation. All rights reserved.

3

1. Disconnect the electrical connections.
2. If replacing the communication interface module be sure to transfer Bluetooth antenna, if equipped.
3. For programming and set up procedures, refer to [Control Module References](#).